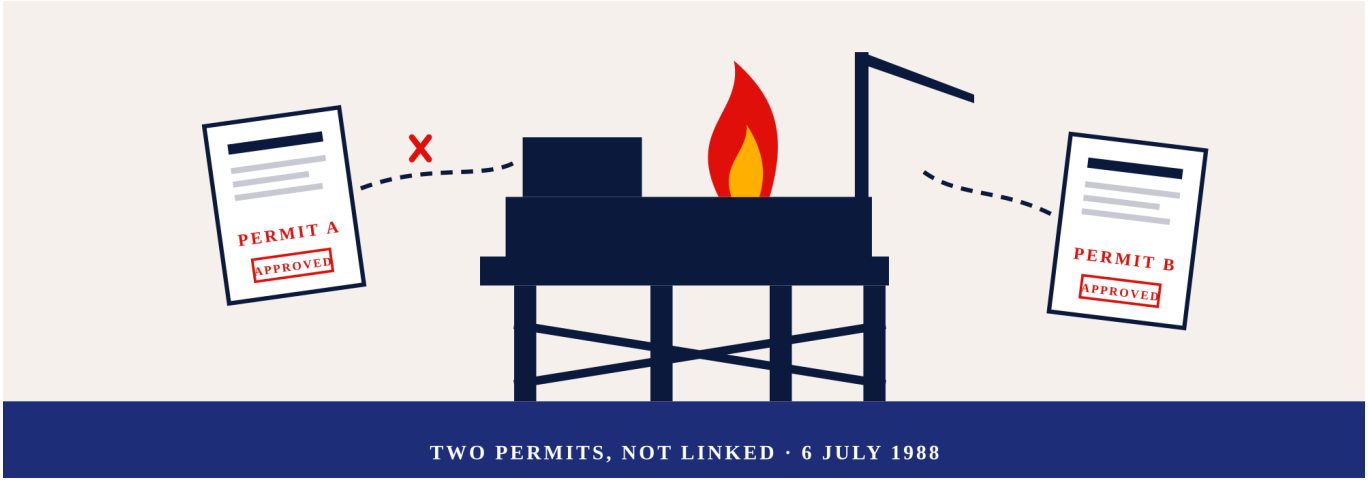


Piper Alpha, 1988: lessons in work control, containment and emergency readiness

A reliability and asset management reading of the case, with five practical checks for operators

Published by AFDARA & Co. · Version 1.3 · 22 November 2026 · linkedin.com/company/afdara-co

ABSTRACT

On 6 July 1988 the Piper Alpha platform in the UK North Sea was destroyed by explosions and fire; 167 people died [1][3]. Cullen's most-probable reconstruction linked the first release to a temporary closure that was not leak-tight. The system was pressurised during steps to reinstate pump A while its pressure safety valve was removed; the decisive action was not directly witnessed [1]. We review it with a bow-tie-inspired sketch, a contributing-factor map, RCM and an ISO 55001:2024 lens, and turn it into five checks.

KEY FINDINGS

1. Containment most probably failed at a temporary blind-flange assembly [1][3].
2. Permit linkage and handover shared work-control weaknesses; physical isolation was a separate gap [1][3].
3. Mitigation was degraded: firewater on manual, loss of main power and the control room, and corroded firewater piping [1][3][9].
4. Relevant deficiencies and prior incidents were recorded before the disaster [7][9][10].

Of 226 people on Piper Alpha, 165 died and 61 survived; two crew of the rescue craft Sandhaven also died, bringing total fatalities to 167 [1][3].

01 Context and purpose

Piper Alpha was a large fixed platform about 120 miles north-east of Aberdeen. Built for oil, it was later modified to process and export gas, and it sat at the hub of a pipeline network [3].

About this brief. A practitioner interpretation from public sources by AFDARA & Co.; not legal or engineering advice and not peer-reviewed. An external editorial review was carried out in November 2026; no independent engineering review has been carried out for this release. Figures, evidence check and indicators are AFDARA tools, not taken from the Cullen report.

02 The most probable sequence

On the day shift, the pressure safety valve (PSV) for condensate pump A was removed. A blind flange was fitted at its location on the relief line, above and away from the pump. The temporary blank-flange assembly was not leak-tight; it was not leak- or pressure-tested [6]. Some secondary accounts describe it as loosely installed [9]; Cullen's formulation is that the assembly was not leak-tight, and its exact tightening condition is not established [1]. The pump and valve work sat under separate permits

that were not linked, and the night crew did not know the PSV was missing [1].

At about 21:45–21:50, pump B tripped and restart attempts were unsuccessful. Operators then took steps to reinstate pump A. Cullen inferred that condensate was admitted to the system, but the decisive action was not directly witnessed. On a balance of probabilities, the blind-flange assembly was the leak source [1][3].

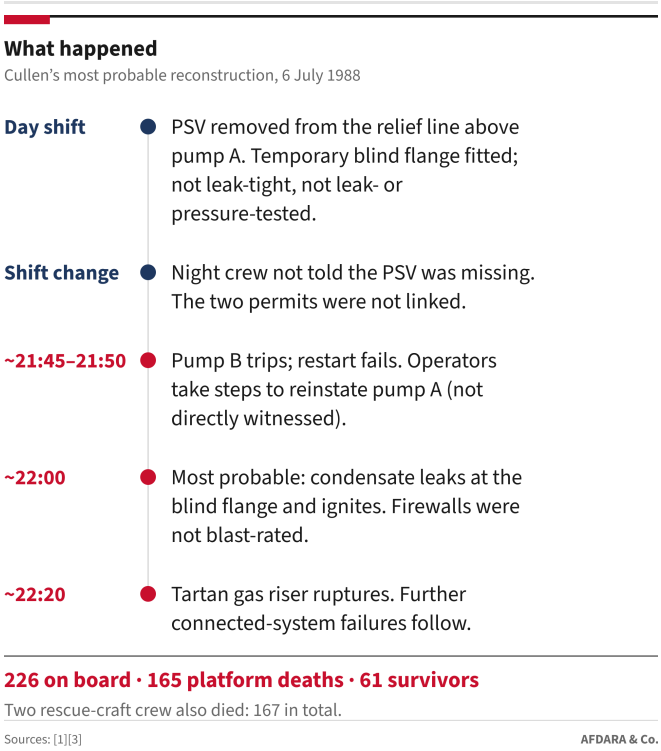


Figure 1. A simplified rendering of Cullen's most probable reconstruction, not a minute-by-minute log. AFDARA diagram, not an official inquiry figure [1][3][6].

03 Reliability and barrier analysis

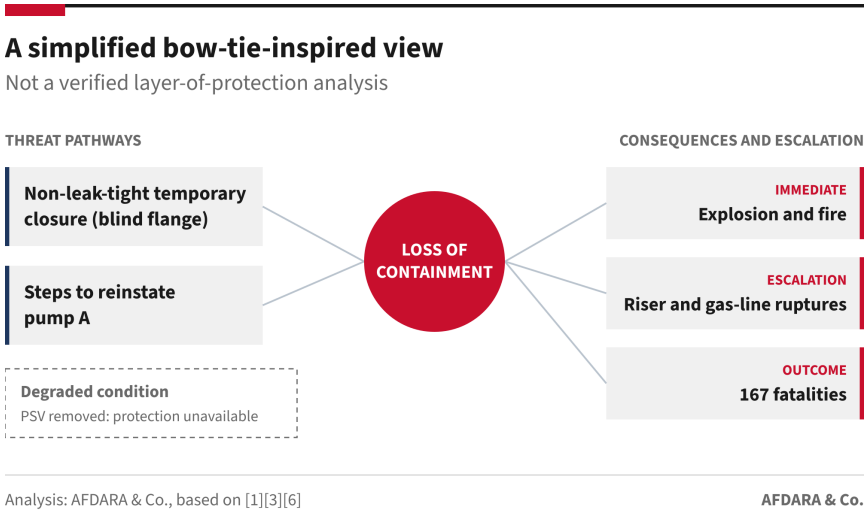


Figure 2. A qualitative cause–consequence sketch: prevention and mitigation controls are listed in this caption, not drawn as barrier nodes. It is a communication model, not a safety-case demonstration, LOPA, QRA, or evidence that the listed barriers were independent [16][17]. Controls that failed or were unavailable: *prevention* — permit linkage, shift handover, effective physical isolation; *mitigation* — firewalls designed for fire separation, not blast resistance; firewater on manual, then disabled by damage or loss of power; emergency command and escape, shutdown authority on connected platforms [1][3][6][15].

Controls that were not independent. Permit linkage and handover shared work-control weaknesses; the lack of effective physical isolation was a separate deficiency. Escalation followed: the firewalls were designed for fire separation, not blast resistance, and the Tartan riser ruptured at about 22:20 [1][3][6].

Neighbouring platforms. Cullen found the offshore installation managers on Claymore and Tartan ill-prepared for an emergency on a connected installation [1]. An earlier shutdown of oil production on the connected platforms would probably have delayed the Tartan riser rupture; the timing of gas-line depressurisation would not materially have affected the Piper fire, and the outcome of earlier action remains uncertain [1][3].

Firewater was more than one problem. The pumps were on manual because of diving operations, so starting them needed manual intervention [1][9]. The first explosion also put the main power supply and the control room out of action [1][15], and firewater distribution piping in the worst-affected module was badly corroded, with about

half its sprinkler heads found plugged in tests in May 1988 [1][9].

04 Contributing causes and organisational learning

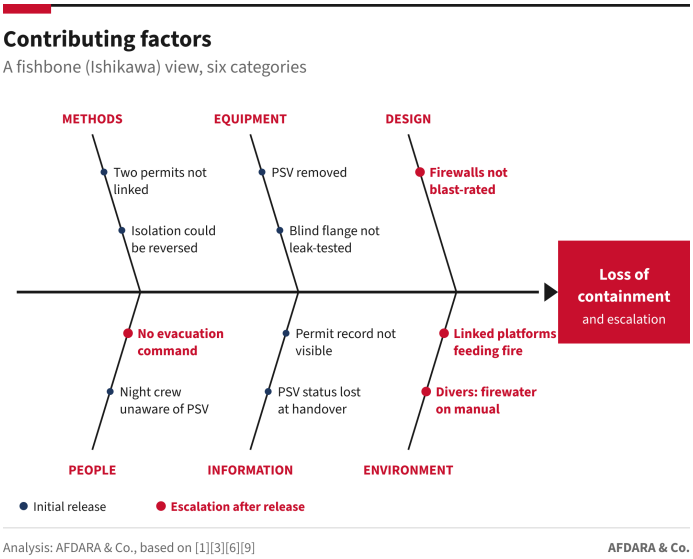


Figure 3. A workshop aid by AFDARA & Co.: a contributing-factor map for structuring discussion. It is a practitioner interpretation, not Cullen's taxonomy or a complete accident model [1][3][6][9].

One selected branch (workshop aid). Following a single chain of "why?": condensate most probably escaped at the temporary closure; the line was pressurised because the crew did not know the PSV was missing; they did not know because the permits were not linked and handover did not pass it on; the pump could be reinstated because isolation could be reversed before the work was complete [1][3]. Real causation had several branches.

Recorded signals. Relevant deficiencies and prior incidents were recorded before the disaster, including concerns about firewater arrangements: a 1983 audit recommended ending the practice of keeping the pumps on manual [9]. Hansard confirms that a report on a 1984 Piper Alpha explosion existed and was to go to the inquiry; its findings are not assessed here [10]. Regulator inspections had found deficiencies [7]. Paté-Cornell traces the technical failures to organisational roots and supports combined technical and organisational risk reduction [5].

RCM QUESTION	APPLIED TO THE PSV
1 Function	Relieve overpressure on pump A's discharge.
2 Functional failure	Fails to relieve on demand, including when not installed.
3 Failure mode	Removed for maintenance while the pump can still start.
4 Effect	Routine operation may not reveal that required protection is unavailable.
5 Consequence	Known impairment of normally hidden protection; combined failures could have safety consequences.
6 Proactive task	Assess applicable and effective preventive tasks; none is selected by this illustration.
7 If no proactive task	Failure-finding is one possible policy, not automatic; if chosen, it must cover the full function, with justified interval and test risk.
Operational rule	Separately: no return to service while required protection is unavailable, unless site-approved risk controls authorise it.

Table 1. Illustrative application of RCM questions to a known maintenance impairment of a normally hidden protective function; not a complete RCM analysis or a quotation from SAE JA1011_202411 [14]. It does not authorise operation without protection [1].

> **TAKEAWAY**
> Strengthen work control alongside process design, physical isolation, escalation prevention and emergency response.

05 A retrospective ISO 55001 lens

Viewed retrospectively through ISO 55001:2024, the case raises questions about risk, change, information and operational control. These are illustrative management-system questions, not a historical audit or a finding of

nonconformity. ISO 55001 did not exist in 1988, does not specify a UK safety case or barrier regime, and complements rather than replaces process-safety and legal requirements [4]. Cullen made 106 recommendations; a principal one helped lead to the safety-case regime [1][7]. The 1992 Safety Case Regulations [2] were later replaced by SCR 2005, subject to transitional provisions; SCR 2015 replaced SCR 2005 in British external waters, while SCR 2005 continues, as amended, in Great Britain internal waters [8]. Fire, explosion and emergency-response duties sit under PFEER 1995, as amended, which is distinct from the safety-case regime [18].

HISTORICAL CONTROL ISSUE IN THIS BRIEF	ILLUSTRATIVE ISO 55001:2024 QUESTION TODAY
Unavailable protection not controlled	6.1.2 Actions to address risk
Untested temporary closure on a live system	6.3 Planning of changes · 8.2 Control of change
Pump status lost at shift change	7.4 Communication · 7.6 Data and information
Permits did not link the jobs	8.1 Operational planning and control

Table 2. Selected illustrative mappings [4]. Clause 6.3 covers planning of changes and 8.2 control of change; 7.4, 7.6 and 8.1 do not mandate a particular handover, register or permit-linkage process.

06 A maintenance-state screen

CONDITION	POSSIBLE EFFECT	SAFER ACTION
Safety device removed; equipment still startable	Overpressure with protection unavailable	Record the impairment; prevent restart until status is verified
Temporary closure on a live system	Loss of containment when pressurised	Engineering-approved integrity/leak test suited to equipment, code, medium and scope
Isolation reversed before work is complete	Equipment live in a maintenance state	Release only via authorised isolation and permit hand-back, with verification
Status lost at shift change	Wrong decision by incoming crew	Written handover, face-to-face clarification, cross-check
Firewater left on manual	No automatic deluge when needed	Visible mode status; approved exceptions only

Table 3. Illustrative FMEA-style condition–effect–action screen [11][13]; not a complete IEC 60812 FMEA, which would also define function boundary, causes, detection, prioritisation, owner and closure. Methods, limits and hand-back authority come from site procedures. FMEA treats failure modes one at a time and can miss common-cause interactions.

Evidence check (AFDARA heuristic). For each critical control, look for evidence that it *exists*, is *understood*, is *implemented* (sampled records and observations) and *performs* under defined conditions. Piper Alpha had a permit system [1]; the gaps lay in implementation and performance.

07 Five practical checks and risk-linked monitoring

1. **Impairment register.** Record every safety device removed, impaired or bypassed: authorisation, compensating measures, owner, review and escalation rule, restoration route and close-out evidence [11][19].
2. **Permits and isolation.** Cross-reference related permits. Permit linkage is not proof of isolation integrity: prove isolations on site under the approved isolation procedure [11][19].
3. **Handover.** Cover outstanding work, permit and isolation status, plant status, impaired protection and temporary configurations, with face-to-face clarification and acceptance by the incoming authority [19].
4. **Temporary closures.** Treat them as changes: approved, equipment-specific test success criteria and boundary, records, failed-test response, permit and isolation reconciliation, restored protection, and authorised acceptance before hand-back or restart [11][19].
5. **Degraded scenarios.** Exercise credible escalation scenarios with lost support systems and alternative escape; measure objectives, observed performance, decisions, and closure of corrective actions [18].

Illustrative indicators

INDICATOR	DEFINITION TO SET	RESPONSE RULE
Impaired safety devices	Every defeated device, tracked from the moment of impairment	Immediate risk review, compensating measures, named owner, escalation
Permit–isolation linkage	% of sampled permits with all related isolations cross-referenced	Review the work-control step that failed
Temporary configurations	Number past their approved close-out date	Owner re-approves or restores
Exercise coverage	Scenarios exercised against plan (coverage, not proof of readiness)	Schedule missed scenarios; track corrective actions to closure

No waiting period, such as seven days, is an acceptable default for an impaired safety device. Thresholds and monitoring frequencies (for example same shift or daily for high-consequence impairments) are AFDARA heuristics and must be set by site risk assessment, not read as ISO 55001 or statutory limits. For each indicator define scope, numerator and denominator, time window, tolerance, owner, response and closure evidence. Indicators give early warning, not prediction [12].

QUESTION FOR YOUR TEAM

Which protective device on your site is impaired today, and who owns its restoration?

References

1. The Hon. Lord Cullen (1990). The Public Inquiry into the Piper Alpha Disaster, Vols 1–2. Cm 1310. HMSO, London. Primary historical authority. hse.gov.uk
2. The Offshore Installations (Safety Case) Regulations 1992, SI 1992/2885. Historical; replaced by the 2005 Regulations. legislation.gov.uk
3. Macleod, F. and Richardson, S. (2018). Piper Alpha: What have we learned? Loss Prevention Bulletin 261, IChemE. icheme.org
4. ISO 55001:2024. Asset management: Asset management system: Requirements. ISO, Geneva. iso.org
5. Paté-Cornell, M. E. (1993). Learning from the Piper Alpha accident: a postmortem analysis of technical and organizational factors. Risk Analysis 13(2), 215–232. doi:10.1111/j.1539-6924.1993.tb01071.x doi.org
6. Macleod, F. and Richardson, S. (2018). Piper Alpha: the disaster in detail. The Chemical Engineer. Same authors as [3]; a professional account, not an independent study. thechemicalengineer.com
7. Hansard, HC Deb 12 November 1990, vol 180, cc329–44. Statement on the Cullen report. api.parliament.uk
8. HSE (2015). L154: The Offshore Installations (Offshore Safety Directive) (Safety Case etc) Regulations 2015. Guidance on Regulations. hse.gov.uk
9. AIChE/CCPS. Piper Alpha case history: a condensed secondary summary based on the Cullen report. aiche.org
10. Hansard, HC Deb 25 July 1988, vol 138, cc86–7W. Written answers on the Piper Alpha disaster. api.parliament.uk
11. HSE (2006). HSG253: The safe isolation of plant and equipment. 2nd edn. hse.gov.uk
12. HSE (2006). HSG254: Developing process safety indicators. hse.gov.uk
13. IEC 60812:2018. Failure modes and effects analysis (FMEA and FMECA). IEC, Geneva. webstore.iec.ch
14. SAE JA1011_202411 (revised 5 November 2024). Evaluation Criteria for Reliability-Centered Maintenance (RCM) Processes. SAE International. doi.org
15. Oil & Gas Journal (19 November 1990). Piper Alpha report to spawn many changes in UK regs. Report on the Cullen findings. ogj.com
16. de Ruijter, A. and Guldenmund, F. (2016). The bowtie method: A review. Safety Science 88, 211–218. doi.org
17. Markowski, A. S. and Kotynia, A. (2011). “Bow-tie” model in layer of protection analysis. Process Safety and Environmental Protection 89(4), 205–213. Methodological background only.
18. HSE (2016). L65: Prevention of fire and explosion, and emergency response on offshore installations (PFEER 1995). 3rd edn. hse.gov.uk
19. HSE (2005). HSG250: Guidance on permit-to-work systems. hse.gov.uk